Hinkley Lighting I.S. 196 4419

Instructions for Assembling and Installing Fixtures in the United States


- 1) Install large arms (A) to bottom body of center column (B) with lockwashers (C) and hexnuts (D). Bottom body is the larger one. Tighten hexnuts, a 14mm or 9/16" box wrench is recommended.
- 2) Connect 6 black socket wires to one of the black wires in center column assembly (B) with wire connectors (E). Repeat for other 6 black socket wires. Repeat for 6 white socket wires and one white center column wire. Repeat for other 6 white socket wires. If wires are not black and white, refer to chart for correct connection.

CAUTION: Make sure all wires are stripped 5/8" (16mm) and no loose wire strands are outside the connectors. As an added precaution, wire connections should be wrapped with electrical tape.

- 3) Install 1 1/2" long nipple (AA) into hickey (EE) in bottom body. Install laige body cover (BB), -making sure all wires are located inside bottom body and secure in place with coupling (CC).
- 4) Install medium arms (F) to top body of center column assembly (B) with lockwashers (C) and hexnuts (D). Tighten nexnuts.
- 5) Thread 10" (254mm) nipple (K) into luckey (J) so that 1/4" (6.4mm) is to the inside of the hickey. Thread hexnut (W) onto the nipple on the inside of the hickey and tighten.
- 6) Feed 2 black and 2 white wires through nipple (K) so that 5" (127mm) are in the body.
- 7) Connect 3 black socket wires to one black wire from center column (B) and one black wire from nipple (K) with wire connector (E). Repeat for other 3 black socket wires. Repeat for 3 white socket wires and one white wire from nipple (K). Repeat for other 3 white socket wires. If wires are not black and white, refer to chart for correct. connections.

Connect Black or Red House Wire to:	Connect White House Wire to:
Black	White
* Parallel cord (round & smooth)	Parallel cord (square and ridged)
Clear, Brown, Gold, or Black without tracer	Clear, Brown, Gold, or Black with tracer
Insulated wire (other than green) with copper conductor	Insulated wire (other than green) with silver conductor

. Note: When parallel wire (SPT I & SPT II) is used. The tracer wire is square shaped or ridged and the other wire will be round in shape or smooth. (See illus.)

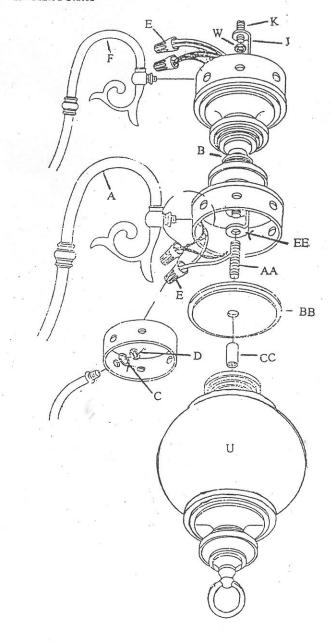

CAUTION: Make sure all wires are stripped 5/8" (16mm) and no loose wire strands are outside the connectors. As an added precaution, wire connections should be wrapped with electrical

Date Issued 1/98


(Cont'd on back)

Instructions for Assembling and Installing Fixtures in the United States (Cont'd)

- 8) Position wires inside body and slip body cover (DD) over nipple (K). Position column (M) on body cover (DD).
- 9) Thread nipple (P) into hickey (R) so that 1/4" (6.4mm) is to the inside of the hickey. Thread hexnut (W) onto the nipple on the inside of the hickey and tighten. Install lockwasher (X) onto nipple (P) and thread coupling (H) onto nipple (P) on the outside of hickey (R) and tighten. SEE DETAIL-MAY ALREADY BE ASSEMBLED.
- 10) Position top body (N) on column (M) so that holes for the arms are between the medium arms (F). Thread hickey assembly (R) onto nipple (K) inside body (N) and tighten. Slip lockwasher (X) onto nipple (K) inside hickey (R) and secure in place with hexnut (W).
- 11) Install small arms (S) to top body of center column assembly (M) with lockwashers (C) and hexnuts (D). Tighten hexnuts.
- 12) Feed fixture supply wires through top column assembly (T). Feed fixture supply wires through top coupling/hickey assembly (R) so that 5" (127mm) of wire are in the body.
- 13) Connect black socket wires to black wires from center column (B) and correct fixture supply wire, refer to wire chart for correct connection, with wire connectors (E). Repeat for white

CAUTION: Make sure all wires are stripped 5/8" (16mm) and no loose wires strands are tside the connectors. As an added ecaution wire connections should be apped with electrical tape. ake sure all wires are located inside body and rew column into place. Screw bottom ball sembly (U) into place.

OW PROCEED WITH FIXTURE HANGING VSTRUCTIONS.

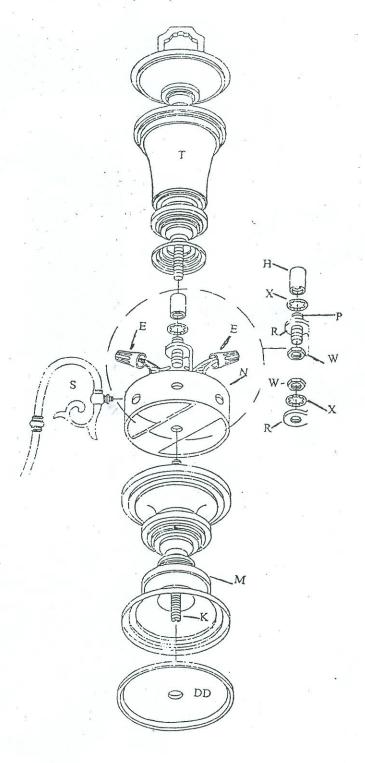

Date Issued: 1/98